

# Digital Stepper Drive 3DM783 Manual



# **Precision Bearing House**®

B 97/4 Naraina Industrial Area Phase I New Delhi India Ph# +919310028857

#### www.pbh.in

Email: ss@pbh.in

New Delhi - Ahmedabad - Chennai



Thanks for selecting Maxima stepper motor driver. We hope that the superior performance, outstanding quality, excellent cost performance of our product can help you accomplish your motion control project.

The content in this manual has been carefully prepared and is believed to be accurate, but no responsibility is assumed for inaccuracies.

All the contents of this manual, copyright is owned by the Precision Bearing House, without Precision Bearing House's permission, no unit or individual/ organisation is allowed to copy.

Precision Bearing House

Version	Editor	Verifier
V1.0	R&D	R&D

# Contents

1. Overview	4 -
2. Features	4 -
3. Ports Introduction	5 -
3.1 Control Signal Input Ports	5 -
3.2 Power Interface Ports	6 -
4. Technological Index	7 -
5. Connections to Control Signal	8 -
5.1 Connections to Common Anode	8 -
5.2 Connections to Common Cathode	8 -
5.3 Connections to Differential Signal	9 -
5.4 Connections to 232 Serial Communication Interface	10 -
5.5 Sequence Chart of Control Signals	11 -
6. DIP Switch Setting	12 -
6.1 Current Setting	12 -
6.2 Standstill current Setting	12 -
6.3 Micro steps Setting	13 -
7. Faults alarm and LED flicker frequency	14 -
8. Appearance and Installation Dimensions(mm)	15 -
9. Typical Connection	15 -
10. Parameter Setting	16 -
11. Processing Methods to Common Problems and Faults	22 -
11.1 Power on power light off	22 -
11.2 Power on red alarm light on	22 -
11.4 After input pulse signal but the motor not running	23 -

# 1. Overview

The 3DM783 is a three phase digital stepper driver based on DSP. Its Micro step resolutions and output current are programmable. And it has advanced control algorithm, which can brings a unique level of system smoothness, provides optimum torque and mid-range instability. The control algorithm of Multi-Stepping can make stepper motor has smooth system performance. The control algorithm of torque compensation can improve the torque of motor in the high speed. The control algorithm of motor self-test and parameter auto-setup technology offers optimum responses with different motors and easy-to-use. The control algorithm of smoothness can enhance the acceleration and deceleration of motor. Its unique features make the 3DM783 to be an ideal solution for applications.


## 2. Features

- Parameter auto-setup and motor self-test
- Multi-Stepping inside
- Small noise, low heating, smooth movement
- Torque compensation in high speed
- Variable current control technology, High current efficiency
- Accelerate and decelerate control inside, Great improvement in smoothness of starting or stopping the motor

- Support PUL/DIR and CW/CCW modes
- Storage the position of motor
- Optically isolated input and compatible with 5V or 24V
- User-defined micro steps
- Micro-step resolutions and Output current programmable
- Over current, over voltage and low voltage protection
- Green light means running while red light means protection or off line

# **3. Ports Introduction**


## **3.1 Control Signal Input Ports**

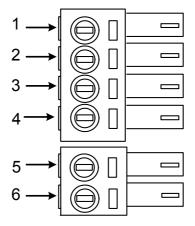

Port	Symbol	Name	Remark
1	PLS+	Pulse signal +	Compatible with
2	PLS-	Pulse signal -	5V or 24V

3	DIR+	Direction signal+	Compatible with
4	DIR-	Direction signal-	5V or 24V
5	ENA+	Enable signal +	Compatible with
6	ENA-	Enable signal-	5V or 24V

## **3.2 Power Interface Ports**

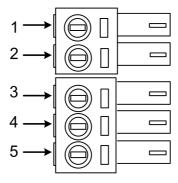


1	Power Input	GND	Input Power-		
2	Ports	+V	Input Power +	DC24V~70V	
3	Motor Phase	U	Phase U		
4	Wire Input	V	Phase V		
5	Ports	W	Phase W		

# 4. Technological Index

Input Voltage		DC24V-70V	
Pulse Frequency max		200K	
Communic	cation rate	57.6Kbps	
Over volt	age value	DC 85V	
Overall Dimen	sions (mm)	118×75.5×34	
Wei	ght	Approximate 260g	
	Environment	Avoid dust, oil fog and corrosive gases	
	Operating	+70°C Max	
Environment	Temperature	+70 C Max	
	Storage	-20°C~+80°C	
Specifications	Temperature	-20 C~+80 C	
	Humidity	40~90%RH	
	Cooling	Natural appling or forgod air appling	
	method	Natural cooling or forced air cooling	

# **5.** Connections to Control Signal


## 5.1 Connections to Common Anode

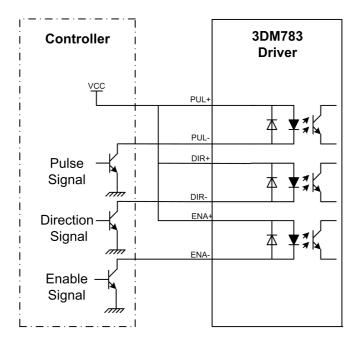

#### **Remark:**

VCC is compatible with 5V or 24V.


### 5.2 Connections to Common Cathode

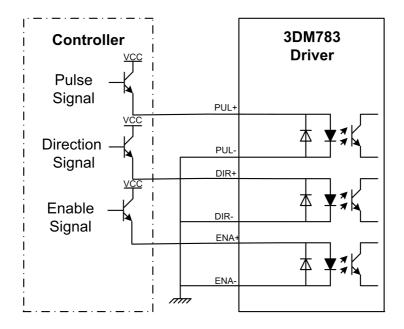

#### **Remark:**

VCC is compatible with 5V or 24V.


## **5.3** Connections to Differential Signal

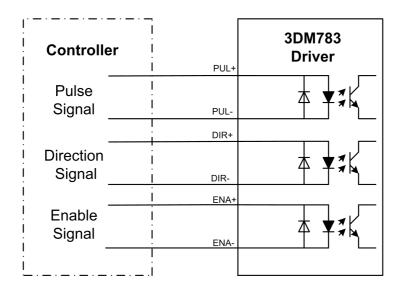

#### **Remark:**

VCC is compatible with 5V or 24V.


## 5.4 Connections to 232 Serial Communication Interface

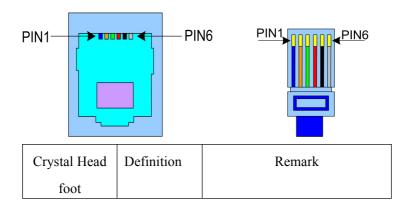

1	TXD	Transmit Data	
2	RXD	Receive Data	
4	+5V	Power Supply to HISU	
6	GND	Power Ground	

### 5.5 Sequence Chart of Control Signals

In order to avoid some fault operations and deviations, PUL, DIR and ENA should abide by some rules, shown as following diagram:

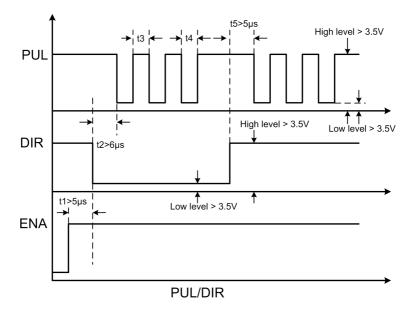

#### **Remark:**

a. t1: ENA must be ahead of DIR by at least 5  $\mu$  s. Usually, ENA+ and ENA- are NC (not connected).

b. t2: DIR must be ahead of PUL active edge by 6  $\mu$  s to ensure correct direction;

- c. t3: Pulse width not less than  $2.5 \mu$  s;
- d. t4: Low level width not less than 2.5  $\mu$  s.

# 6. DIP Switch Setting

## 6.1 Current Setting

The current setting is in the following table.

Dial switch				
Current		SW1	SW2	SW3
Peak	RMS			
2.1A	1.5A	0	0	0
3.15A	2.25A	1	0	0
4. 03A	2.88A	0	1	0
4.78A	3.42A	1	1	0
5.69A	4.06A	0	0	1
6.44A	4.60A	1	0	1
7.35A	5.25A	0	1	1
8.4A	6. 0A	1	1	1

#### 6.2 Standstill current Setting

SW4 is used for setting the standstill current, "off" means the standstill current is set to be half of the selected dynamic current or other current, which can be set by the HISU, the details can be seen in the tenth

sections. While "on" means the standstill current is set to be the same as the selected dynamic current.

 
### 6.3 Micro steps Setting

The micro steps setting is in the following table. And the micro steps can be also setting through the HISU. The details can be seen in the tenth sections.

Dial witch	SW5	SW6	SW7	SW8
Micro steps				
400	1	1	1	1
800	0	1	1	1
1600	1	0	1	1
3200	0	0	1	1
6400	1	1	0	1
12800	0	1	0	1
25600	1	0	0	1
51200	0	0	0	1
1000	1	1	1	0
2000	0	1	1	0
4000	1	0	1	0
5000	0	0	1	0
8000	1	1	0	0


10000	0	1	0	0
20000	1	0	0	0
40000	0	0	0	0


# 7. Faults alarm and LED flicker frequency



Flicker	Description to the Faults
Frequency	
1	Error occurs when the motor coil current exceeds
	the drive's current limit.
2	Voltage reference error in the drive
3	Parameters upload error in the drive
4	Error occurs when the input voltage exceeds the
	drive's voltage limit.


# 8. Appearance and Installation Dimensions(mm)

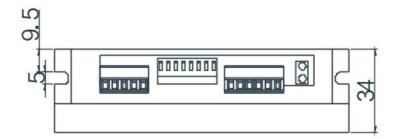

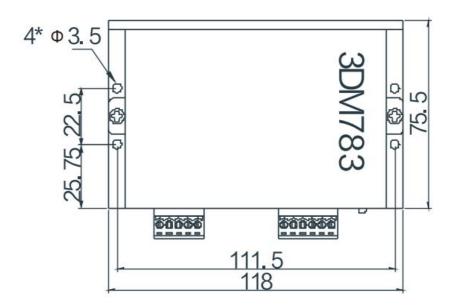

# 9. Typical Connection

Here is the typical connection of 3DM783.

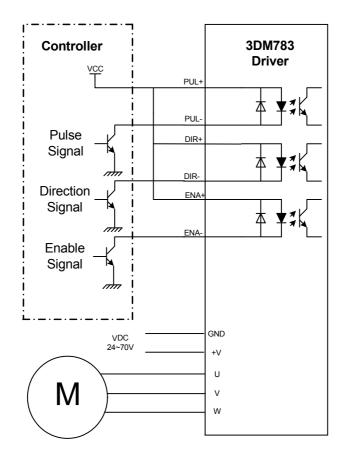

## **10.** Parameter Setting

The parameter setting method of 3DM783 drive is to use a HISU adjuster through the 232 serial communication ports, only in this way we can set the parameters we want. There are a set of best default parameters to the corresponding motor which are carefully adjusted by our engineers, users only need refer to the following table, specific condition and set the correct parameters.

Mode	Definition	Range	Dime-	Drive	Default
			nsion	Restart	Value
P1	Current loop Kp	0—4000	1	N	40
P2	Current loop Ki	0—1000	1	Ν	110
P3	Damping coefficient	0—500	1	Ν	270
P4	Amplitude of first	0—100	1	Ν	0
	resonance point				
P5	Phase of first	0—100	1	Ν	0
	resonance point				
P6	Amplitude of	0—100	1	Ν	0
	second resonance				
	point				
<b>P7</b>	Phase of second	0—100	1	N	0
	resonance point				
P8	Amplitude of	0—1000	1	N	0
	Third resonance				
	point				
P9	Phase of Third	0—1000	1	N	0
	resonance point				
P10	Enable signal level	0—1	1	N	0
P11	Edge of the pulse	0—1	1	Y	1
P12	Reserved				
P13	Command Type	0—1	1	Υ	0
P14	User-defined micro	4—1000	50	Y	0
	steps				
P15	Time of standstill	0—4000	1ms	Υ	800

### Actual value = Set value $\times$ the corresponding dimension

	current				
P16	Percentage of	0—100	1	Y	50
	standstill current				
P17	Speed smoothness	0—10	1	Y	0
P18	Enable of position	0—1	1	Y	0
	memory				
P19	User-defined	0—1000	mh	Y	0
	inductance of motor				
P20	User-defined	0—100	0.10hm	Y	0
	resistance of motor				
P21	Result of position				
	memory(Read only)				
P22	Time of enable	0—100	1s	Y	2
	position memory				
P23	Reserved				
P24	Inductance of		0.1mh		
	motor(Read only)				
P25	Resistance of		0.10hm		
	motor(Read only)				

There are total 25 parameter configurations, use the HISU to download the configured parameters to the drive, the detail descriptions to every parameter configuration are as follows:

Item Description
------------------

Current loop Kp (P1) Current loop Ki (P2)	The P1 and P2 is used to set Kp and Ki of Current loop at the moment of power-on.	
Damping coefficient (P3)	This parameter is used to change the damping coefficient in case of the desired operating state is under resonance frequency. This parameter is useful in high speed.	
	3DM783 Driver provides robust anti-resonance control to stop the vibrations and maintain equilibrium.	
Amp 1—3 Phase 1—3	Amp1 and Phase1 is Phase adjustment for 1st andAmplitude adjustment for 1st resonance arearespectively. Usually between 0.6rps and 1.2rps.	
(P4,P5,P6,P7,P8, P9)	Amp2 and Phase2 is Phase adjustment for 2nd and Amplitude adjustment for 2nd resonance area respectively. Usually between 1.2rps and 2.4rps.	
	<b>Amp3</b> and <b>Phase3</b> is Phase adjustment for 3rd and Amplitude adjustment for 3rd resonance area respectively. Usually between 3rps and 4rps.	
Enable signal	This parameter is set to control the Enable Input	

level	signal level. 0 means low, while 1 means high.
(P10)	
Edge of the pulse	This parameter is set to choice the edge of the input
(P11)	pulse. 0 means rising edge, while 1 means falling
	edge.
Command Type	This parameter is set to choice the PUL/DIR mode
	or CW/CCW mode. 0 means PUL/DIR mode, while
(P13)	means CW/CCW mode.
	This parameter is set of user-defined micro steps.
User-defined	The actual micro steps = the set value $\times$ 50. For
micro steps	example, if the parameter is 4, the micro steps is 4
(P14)	$\times$ 50 = 800. But if this parameter is 0, which means
	micro steps is set by the outer DIP switches.
Time of	This parameter is set the time when the standstill
standstill current	current is set to be half of the selected dynamic
(P15)	current or other current.
Percentage of	This parameter is set the percentage of standstill
standstill current	current.
(P16)	
Speed	This parameter is set to control the smoothness of
smoothness	the speed of the motor while acceleration or
(P17)	deceleration, the larger the value, the smoother the
	speed in acceleration or deceleration.

	0 1 2 10
Enable of position memory (P18)	This parameter is set to enable the function of position memory. 0 means disable, while 1 means enable. If set 1, the 3DM783 can remember the position of motor in the next time of power on.
User-defined inductance of motor (P19)	This parameter is set the inductance of motor. 0 means 3DM783 gets the inductance by control algorithm of Parameter auto-setup, while other parameter means 3DM783 gets the inductance through user sets.
User-defined resistance of motor (P20)	This parameter is set the resistance of motor. 0 means 3DM783 gets the resistance by control algorithm of Parameter auto-setup, while other parameter means 3DM783 gets the resistance through user sets.
Result of	This parameter is set to control the smoothness of

position memory	Display the result of position memory	
(P21)		
Time of enable	This parameter is set of the time when enable the	
position memory	position memory. The time is mean the space of	
(P22)	time to stop plus input.	
P24	This Read Only parameter is used to know the	
	inductance of motor by control algorithm of	
	Parameter auto-setup.	
P25	This Read Only parameter is used to know the	
	resistance of motor by control algorithm of	
	Parameter auto-setup.	

# 11. Processing Methods to Common Problems and

# Faults

## 11.1 Power on power light off

 No power input, please check the power supply circuit. The voltage is too low.

## 11.2 Power on red alarm light on

- Please check the motor is connected with the drive.
- The stepper digital drive is over voltage or under voltage. Please lower or increase the input voltage.

#### 11.4 After input pulse signal but the motor not running

- Please check the input pulse signal wires are connected in reliable way.
- Please make sure the input pulse mode is corresponding with the real input mode.
- The Driver is disabled.